

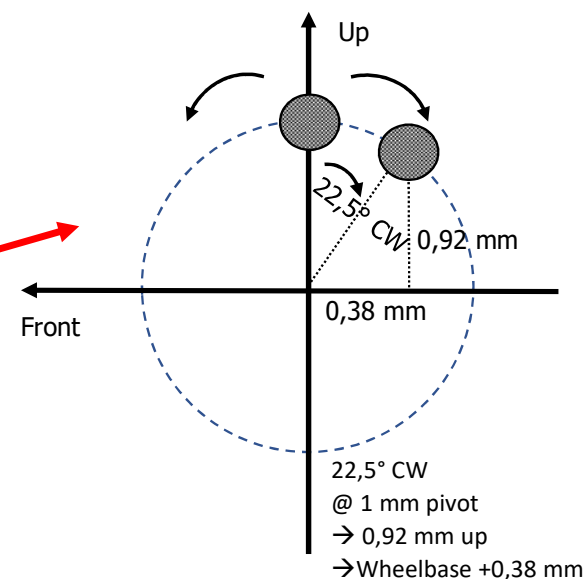


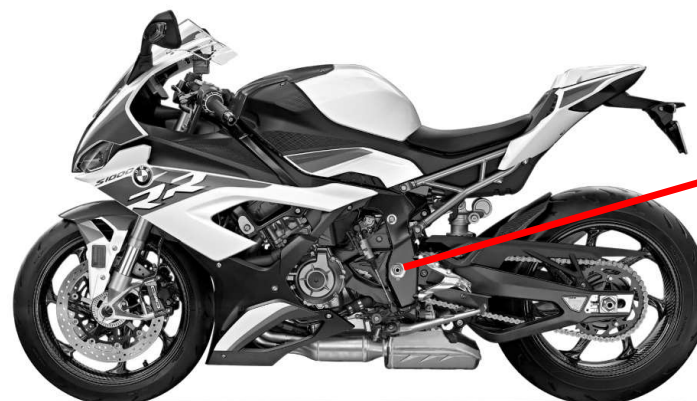

Reference is the 0 mm alpha Racing pivot !
Left side 4651 B100 A00
Right side 4651 B101 B00

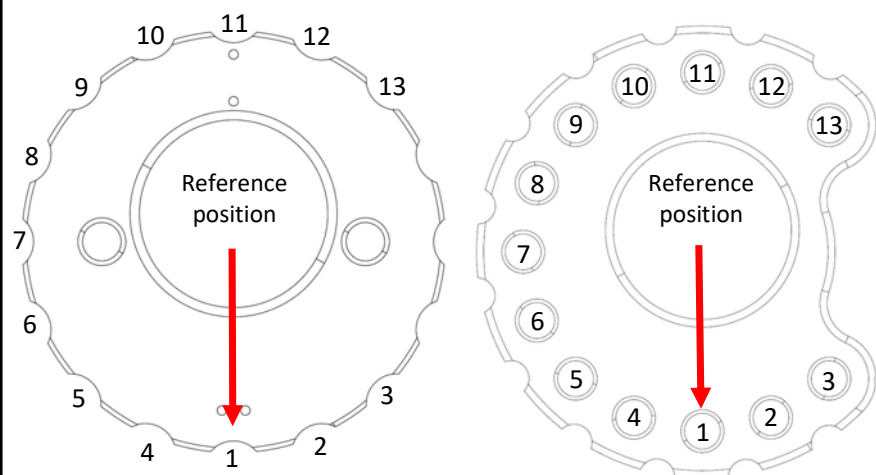

1 mm swingarm pivot (LH: ...B100 B00 RH: ...B101 B00)						
counterclockwise			deg [°]	clockwise		
Pos.	front [mm]	up [mm]		up [mm]	front [mm]	Pos.
1	0,00	1,00	0,0	1,00	0,00	1
4	-0,38	0,92	22,5	0,92	0,38	2
5	-0,71	0,71	45,0	0,71	0,71	3
6	-0,92	0,38	67,5			
7	-1,00	0,00	90,0			
8	-0,92	-0,38	112,5			
9	-0,71	-0,71	135,0			
10	-0,38	-0,92	157,5			
11	0,00	-1,00	180,0			
12	0,38	-0,92	202,5			
13	0,71	-0,71	225,0			

2 mm swingarm pivot (LH: ...C100 B00 RH: ...C101 B00)						
counterclockwise			deg [°]	clockwise		
Pos.	front [mm]	up [mm]		up [mm]	front [mm]	Pos.
1	0,00	2,00	0,0	2,00	0,00	1
4	-0,76	1,84	22,5	1,84	0,76	2
5	-1,42	1,42	45,0	1,42	1,42	3
6	-1,84	0,76	67,5			
7	-2,00	0,00	90,0			
8	-1,84	-0,76	112,5			
9	-1,42	-1,42	135,0			
10	-0,76	-1,84	157,5			
11	0,00	-2,00	180,0			
12	0,76	-1,84	202,5			
13	1,42	-1,42	225,0			

3 mm swingarm pivot (LH: ...B100 D00 RH: ...B101 D00)						
counterclockwise			deg [°]	clockwise		
Pos.	front [mm]	up [mm]		up [mm]	front [mm]	Pos.
1	0,00	3,00	0,0	3,00	0,00	1
4	-1,14	2,76	22,5	2,76	1,14	2
5	-2,13	2,13	45,0	2,13	2,13	3
6	-2,76	1,14	67,5			
7	-3,00	0,00	90,0			
8	-2,76	-1,14	112,5			
9	-2,13	-2,13	135,0			
10	-1,14	-2,76	157,5			
11	0,00	-3,00	180,0			
12	1,14	-2,76	202,5			
13	2,13	-2,13	225,0			